THE ANALYSIS OF SLIDING SURFACE IN ALO WATERSHED, GORONTALO DISTRICT, INDONESIA

by Aang Panji Permana

Submission date: 25-Oct-2022 08:27AM (UTC-0400)

Submission ID: 1934922797

File name: ING-SURFACE-IN-ALO-WATERSHED-GORONTALO-DISTRICT-INDONESIA_1.pdf (1.55M)

Word count: 3343

Character count: 18114

OF THE NATONAL ACADEMY OF SCIENCES OF THE REPUBLIC OF KAZAKHSTAN

SERIES OF GEOLOGY AND TECHNICAL SCIENCES

ISSN 2224-5227

Volume 3, Number 447 (2021), 53-58

https://doi.org/10.32014/2021.2518-170X.62

Fitryane Lihawa¹, Ahmad Zainuri¹, Indriati Martha Patuti², Aang Panji Permana¹, I Gusti Nyoman Yuda Pradana¹

¹Earth Science and Technology Department, Faculty of Mathematic and Natural Science, Universitas Negri Gorontalo, Gorontalo, Indonesia

²Civil Engineering Department, Faculty of Engineering, Universitas Negeri Gorontalo, Gorontalo, Indonesia

E-mail: aang@ung.ac.id

THE ANALYSIS OF SLIDING SURFACE IN ALO WATERSHED, GORONTALO DISTRICT, INDONESIA

Abstract. Allo watershed is the sub-watershed within the system of Limboto watershed which directly disembogues to Limboto Lake. Land degradation happened in the Alo watershed is caused by the agricultural system that does not apply land conservation techniques such as terracing and mounds and it triggers erosion and landslide. The method used in this research is geoelectric method with Wenner Alpha configuration; while the data analysis utilizes resistivity imaging method which produces two-dimensional cross-sectional images. In total, there are seven trajectories with a length of 170-180 meters each. The result of the research presents the slip surfaces of 7 locations are located in 3-17 meters depth with the inclination of 11° -79° trending dominantly northwest and one location trending southeast.

Keywords: Alo Watershed, Gorontalo, Sliding Surface

Introduction. There are not many pieces of research covering landslides in Gorontalo province. The late research shows that the landslides occur in there are rotational slide, planar slide, slide flow, and rock block slide. The landslides are commonly affected by the slope and surface shape of the slope [1]. Alo watershed is the sub-watershed located in Limboto basin system which directly disembogues into Limboto Lake. Alo watershed is one of the largest sediment contributors to Limboto Lake of 0.0342 kg/sec. According to the latest survey conducted by JICA study tam, annual sediment volume is estimated around 5.04 x 106 m³/year (or 5,500 m³/ km²/year). Therefore, if the incoming sediment volume cannot be controlled, it is predicted that within 25 years the Limboto Lake will be filled with sediment [2]. Alo watershed has the biggest sediment contribution of 947,187.87 ton and its SDR reaches 0.59. It reveals that 59% of the eroded sediment will get into Limboto Lake. As the result, the lake will be a land because of silting process. Alo watershed located on Tibawa sub-district has various levels of erosion ranging from very low, low, medium, and high risk. The trigger of these levels of erosion risk is inappropriate utilization of the land [3].

According to the Regional Geological Map of Tilamuta Sheet, scale 1:250,000 [4], Alo watershed is composed from tertiary and quaternary rocks. The rock formations in the Alo watershed are Diorite Bone (Tmb), Bilungala volcanic rock (Tmbv), Dolokapa Formation (Tmd), Pinogu Volcanic Rock (TQpv), and Reef Limestones (Q1). Referring to the

latest research, the name of new limestone formation is Limboto Limestone Formation. This formation consists of two to three microfacies with shallow marine paleobathymetry that have undergone tectonic uplift [5,6]. The slope on Alo watershed is dominated by gentle slopes with slopes ranging from 8 – 15% with a percentage area of 3.14%, and slopes of 15 - 25% are 25.74%. Land usage in Alo watershed is dominated by arid agricultural land with an area percentage of 38.07%, secondary forest of 21.29%, plantation of 14.78%, shrubs of 20.30%, paddy field of 4.17%, and residential area of 1.38%. In general, the practice of agricultural land management in this area has not applied a land conservation technique. The social condition of Alo watershed community in terms of educational level, education level of people residing in Alo watershed is said to still low. Many people agree that farming areas are open. In addition, many people do not quite know about erosion, but many claims to know about erosion. Habits are carried out from generation to generation in cultivations / agricultural practices. There are 78% of the people living in the Alo watershed who agree to log to create farming areas. In cultivating agricultural area, 86% of farmers do not make changes in land cultivation practices and only 14% of farmers follow the advancement of land processing techniques [7].

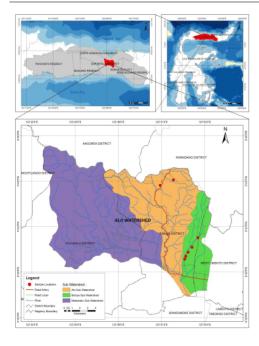


Figure 1. Map of research location in Alo Watershed, Gorontalo District

Methodology. The Alo watershed in the Gorontalo district, with an area of 24,222.41 acres, located at the coordinates of N 00o44' 52.715" and E 122o 49' 33.206' to N 00o 39'59.192" and E 122º 49'12.778" shall be chosen as the research site. The sampling location is in the Tibawa and Limboto sub-districts (Figure 1). Research data is a slip surface that occurs in the Alo sub- watershed. The measurement itself is conducted in seven locations, namely North Isimu Village and Labanu Village, Tibawa Subdistrict & Geoelectric District. Geoelectric measurements are carried out using the Electrical Resistivity Tomography (ERT) method to estimate the boundary or sliding surface below the surface. The ERT method is often used for landslide investigations because the main factors affecting resistance are soil type, porosity and water content [8,9,10,11].

ERT can present 2D and 3D cross-sections of soil and rock resistance distribution, with aximum resolution and depth of measurement depending on the configuration of the electrode [12]. The depth measurement target that can be achieved is approximately 1/5 of the maximum stretch length, i.e. the distance from the first electrode to the last electrode in one line [13]. One measurement line uses the Wenner-Alpha electrode configuration with a stretch length of 180 m for a depth target of about 35 m. Additionally, the acquisition of ERT measurements uses the Wenner-Alpha electrode configuration. The data analysis technique used in this study was a 2D inversion using the 3.54.44

version of RES2DINV based on the least - squares optimization method [14]. Landslide field analysis was performed by adding topographic data to the 2D inversion model using the RES2DINV program [15]. In addition, drill holes BH-01 and BH-02 were added for the calibration and correlation of subsurface resistance prices.

Result and Discussion. The measurement result of the resistivity value and rock type at the research location are shown in Table 1. The data in Table 1 shows that the rock types at 7 locations consist of clay, gravel, sand, limestone and dacite. Geoelectric measurement in research area refers to the inversion result of 2D resistivity imaging on the lines in seven location shown in Figure 2.

Location 1: Geoelectric measurements at location 1 are in North Isimu Village, 180 meters long, with a southwest-northeast trend. The slip plane is usually characterized by a contrasting field between high and low resistance values. Based on the rock resistance value, the slip plane at location 1 is estimated to be in the limestone layer as a layer with a high resistance value. The upper layers of the slip plane with resistance values of less than 674 Ωm were detected or suspected to be clay, gravel and sand layers. The limestone layer, which is a boundary plane or a slip plane, is detected at a depth of about 5-7 meters and has a high resistance of between $674-10,950.5\Omega m$ with an apparent slope of about 8° to the southwest. On the basis of the apparent slope, the actual slope is 47° to the northwest.

Location 2: Geoelectric measurement at location 2 is at North Isimu Village, 180 meters long, with a south-north trend. Based on the rock resistance value, the slip plane at location 2 contains layers of clay, gravel, sand, limestone and dacite. The slip plane at location 2 is estimated to be in the plane of contrast between low and high resistance values. The upper layers of the slip plane with resistance values of less than $692\Omega m$ are thought to be rock layers, i.e. clay, gravel and sand layers. The limestone layer, which is a slip plane, was detected at a depth of about 3 meters and has a high resistance of 692-9,479 Ωm with an apparent slope of about 11° southwest. Based on the apparent slope, the actual slope to the northwest is 79° .

Location 3: Geo-electric measurement at location 3 North Isimu Village with a length of 170 meters trending southwest – northeast. Based on the rock resistance value, the slip plane at location 3 is estimated to be in the contrasting plane between low and high resistance values, i.e. in the limestone layer. A layer of clay, gravel, and sand is thought to be the upper layer of the slip plane, which has a resistance value of less than 796 Ω m.The limestone layer, which is a slip plane, is detected at a depth of about 5-8 meters and has a high resistance of 796-10,552.5 Ω m with an apparent slope of about 7° to the southwest Based on the apparent slope, the actual slope is 74° to the northwest.

Table 1. Electrical Resistance Value and Types of Rock Layers at the Research Location

Location 1	North Isingu Village 1 (0°39'52.6" N,	122°52'36.7" E) - (0°39'55.5" N, 122°5241.6" E)	Electrical Type of	Resistance Layer	0-27.9 Clay	13		54.3 - 80.6 Clay	80.6 - Clay	33	pu	Sand	423.2 – 6/4	674 - Limestone	1 310.5 Timestone	100	1,947 - Limestone	+	3,788 - Limestone	5.629 - Limestone		10,950.5 - Dacite	16.272 – Dacite	31.656	31.656 – Dacite	WWW.
Location 2	North Isimu Village 2 (0°40'3.5" N, 122°52'41.4" E) - (0°40'9" N,	E) - (0°40'9" N, 122°52'43.3" E)	Electrical	Resistance	0-13.7	13.7-	32.15	32.15 -	50.6-	118.8 – 187	187 – 439.5	100 5 000	439.5 – 692	692-1,122 I	1122		-		6,020.5 - I	9,479-	22,277	22,277 -	35,075 -	82,430	82,430 -	
1.2	7.1llage 2 2°52'41.4"	9" N, 3" E)	Type of	Layer	Clav	Clay		Clay	Clay		Gravel &	Sand		Limestone	Limactona	TIMESTONE	Limestone		Limestone	Dacite		Dacite	Dacite		Dacite	
Location 3	North Isigmy Village (0°40'19.6" N,	122°52'51.26" E) (0°40'24.9" N, 122°52'55.19" E)	Electrical	Resistance	0-7.11	7.11-16.5		16.5 – 25.9	25.9 –	60.05 -	94.2-	210.0	218.6 – 343	343 – 796	706 _ 1 240	6471 - 061	1,249 -	2,898.5	2,898.5 -	4.548 -	10,552.5	10,552.5 -	16,557 -	38,418.5	38,418.5 -	
tion 3	y Village 3 9.6" N,	22°52'51.26" E) - (0°40'24.9" N, 122°52'55.19" E)	Type of	Layer	Clav	Clay		Clay	Clay	Clay			Gravel & Sand		Limetone	Tunestone	Limestone		Limestone	Limestone		Dacite	Dacite		Dacite	
Local	North Jsun (0°40'39.1" N	E) (0°40' 122°53'	Electrical	Resistance	0-15.8	15,8-	34.25	34.25 -	52,7-	114,35 -	176 – 381	202 500	381 – 586	-985	1 260 5 -	1,953	1,953 -	4,233	4,233 -	6.513 -	14,113	14,113 -	21,713 -	47,052.5	47,052.5 -	1 100 11
Location 4	North Ising, Village 4 (0°40'39.1" N, 122°53'7.1"	E) – (0°40'36" N, 122°53'1.89" E)	Type of	Layer	Clav	Clay		Clay	Clay		Gravel &	Sand		Limestone	Limestone	rmicsione	Limestone		Limestone	Limestone		Dacite	Dacite		Dacite	
Location 5	North Lynny Village (0°41'17.41" N,	122°53'31.6" E) (0°41'21.4" N, 122°53'28.2" E)	Electrical	Resistance	0-4.29	4.29 -	11.695	11.695 –	19.1 -	51.85 -	84.6 -	230.3	230.3 – 376	376-	1,023	1,670	1,670 -	4,544.5	4,544.5 -	7,419-	20,188	20,188 –	32,957 -	89,681	89,681 –	140 4111
tion 5	Willage 5 7.41" N,	.41" N, 1.6" E) - 1.4" N, 8.2" E)	Type of	Layer	Clav	Clay		Clay	Clay	Clay			Gravel & Sand					Dry	Gravel			Dacite	Dacite		Dacite	
Location 6	Labanu Village 1 (0°44'43.3" N, 122°50'57.2"	E) - (0°44'45.3" N, 122°50'51.8" E)	Electrical	Resistance	0-0.89	0.89-2.05		2.05-3.21	3.21-7.36	7.36-11.5	11.5-26.5	2000	26.5-41.5	41.5-95.25	05.75.140	641-67-66	149-342.5		342.5-536	536-1,232.5		1,232.5-1,929	1,929-4,432.5		4,432.5-6,936	
9 uc	illage 1 122°50'57.2"	45.3" N, 1.8" E)	Type of	Layer	Clav	Clay	,	Clay	Clay	Clay	Loamy	Sand	Loamy	Gravel &	Sand Gravel &	Sand	Gravel &	Sand	Gravel &	Limestone		Limestone	Dacite		Dacite	-
Location 7	Labanu Village 2 (0°45'05.2" N,	122°51'07.3" E) (0°45'05.5" N, 122°51'01.7" E)	Electrical	Resistance	0-3.44	3.44-8.22		8.22-13	13-30.9	30.9-48.8	48.8-116.4	1011711	116.4-184	184-438	439 607	750-054	-269	1,649.5	1,649,5-	2,607-	6,214	6,214-	9,821-	23,406.5	23,406.5-	766.06
7 no	illage 2 5.2" N,	7.3"E)- 5.5"N, 1.7"E)	Type of	Layer	Clav	Clay		Clay	Clay	Clay	Gravel &	Sand	Gravel & Sand	Gravel &	Sand Graval &	Sand	Limestone		Limestone	Dacite		Dacite	Dacite		Dacite	

Source: Analysis Result in 2021



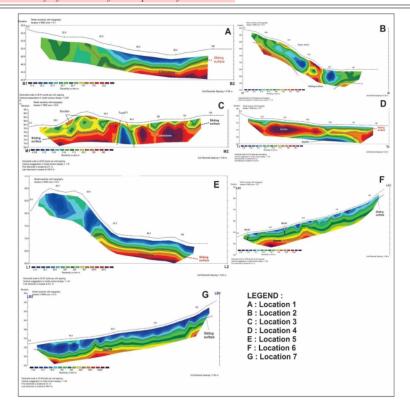


Figure 2. Cross section of 2D resistivity imaging at 7 lines at the research location

Location 4: Geo-electric measurement at location 4 in North Isimu Village with a track length of 180 meters trending northeast - southwest. The limestone layer which is a slip plane is detected at a depth of about 4-5 meters which has a high resistivity ranging from 586-14,113-m with an apparent slope of about 3° to the southwest. Based on the apparent slope, the actual slope is 56° trending the northwest.

Location 5: Geo-electric measurement at location 5 in North Isimu Village with a track length of 180 meters trendingsoutheast - northwest. The slip area is estimated to have low and high resistance values, namely in the dacite layer. The upper layers of the slip plane with resistance values of less than 20,188 -m are thought to be layers of clay, gravel, sand and dry gravel. The igneous rock layer of the dacite, which is a slip plane, was detected at a depth of about 17 meters, which has a high resistance of >20,188 -m, with a true dip of about 11° to the southeast.

Location 6: Geo-electric measurement at location6 in Labanu Village with a track length of 180 meters trendingeast - west. The slip area is estimated in low and high resistance values, namely in the dacite layer. The upper layers of the slip plane with resistance values of less than $536\Omega m$ are thought to be layers of clay, loamy sand, gravel and sand. The limestone layer, which is a slip plane, was detected at a depth of about 2 meters, which has a

resistance of $> 536\Omega m$, with a true dip of about 13° to the east

Location 7: Geo-electric measurement at location 7 in Labanu Village with a track length of 180 meters trending east - west. The slip area is estimated in low and high resistance values, namely in the dacite layer. The upper layers of the slip plane with resistance values of less than 692 Ω m are thought to be layers of clay, gravel and sand. The limestone layer, which is a slip plane, was detected at a depth of about 2-5 meters, which has a resistivity of > 692 Ω m, with a true dip of about 11° to the east.

Conclusion. Based on the results of the interpretation and analysis, it can be concluded that the two-dimensional cross-section of the track at locations 1, 2, 3, 4 and 7 is thought to be the structure of the subsurface soil in the form of clay, gravel and sand. The line at location 5 has a subsurface layer of dry gravel under the sand. The track at location 6 has a sub-surface layer of loamy sand under the layer of clay. The slip plane is interpreted as a limestone layer in line 5 is assumed to be in a dacite igneous rock layer. The results showed that the landslide slip fields at 7 locations were approximately 3-17 meters deep with a slope angle of 110 -79° with trending dominantly northwest and one location with a southeast trend.

Фитран Лихава¹, Ахмад Зайнури¹, Индриати Марта Патути², Аангпанжи Пермана¹ И Густи Ньоман Юда Прадана¹

¹Жердегі ғылым және технология бөлімі, Математика және жаратылыстану факультеті, Universitas Negeri Gorontalo, Горонтало, Индонезия
²Инженерлік факультеті, Usversitas Negeri Gorontalo, Горонтало, Индонезия E-mail: aang@ung.ac.id

АЛО СУ ҚОЙМАСЫНДАҒЫ СЫРҒАНАУ БЕТІН ТАЛДАУ, ГОРОНТАЛО АУДАНЫ, ИНДОНЕЗИЯ

Фитряне Лихава^{1.} Ахмад Зайнури¹, Индриати Марта Патути², АангПанджи Пермана¹, И Густи НьоманЮда Прадана¹

¹Земное отделение науки и техники, Факультет математики и естественных наук, Universitas Negeri Gorontalo, Горонтало, Индонезия
²Инженерный факультет, UniversitasNegeriGorontalo, Горонтало, Индонезия E-mail: aang@ung.ac.id

АНАЛИЗ ПОВЕРХНОСТИ СКОЛЬЖЕНИЯ В ВОДОРАЗДЕЛЕ АЛО, РАЙОН ГОРОНТАЛО, ИНДОНЕЗИЯ

Аннотация. Водораздел Ало - это суб-водораздел в системе водораздела Лимбото, который непосредственно сливается с озером Лимбото. Деградация земель, произошедшая в водосборном бассейне Ало, вызвана сельскохозяйственной системой, которая не применяет методы сохранения земель, такие как террасирование и насыпи, что вызывает эрозию и оползни. Метод, используемый в этом исследовании, является геоэлектрическим методом с конфигурацией Альфа Веннера, в то время как анализ данных использует метод визуализации удельного сопротивления, который создает двумерные изображения поперечного сечения. Всего существует семь траекторий, длиной 170-180 метров каждая. В результате исследования представлены поверхности скольжения в 7 местах, расположенных на глубине 3-17 метров с наклоном 110-79°, направленным преимущественно на северо-запад, и в одном месте, направленном на юго-восток.

Ключевые слова: водораздел ало, Гронтало, поверхность скольжения.

Information about the authors:

5 FitryaneLihawa - Earth Science and Technology Department, Faculty of Mathematic and Natural Science, Universitas Negeri Gorontalo, Gorontalo, Indonesia (5tps://orcid.org/0000-0002-9033-3057)

Ahmad Zainuri - Civil Engineering Department, Faculty of Engineering, Universitas Negeri Gorontalo, Gorontalo, Indonesia: (https://orcid.org/ 0000-0002-2020-6327)

Indriati Martha Patuti- Civil Engineering Department, Faculty of Engineering, Universitas Negeri Gorontalo, Gorontalo, Indonesia (https://orcid.org/ 0000-0002-3678-2564)

AangPanjiPermana - Earth Science and Technology Department, Faculty of Mathematic and Natural Science, Universitas Negeri Gorontalo, Gorontalo, Indonesia (https://orcid.org/0000-0002-6865-3564)

REFERENCES

- [1] Lihawa, F., Patuti, I. M., and Nurfaika. (2014) Sebaran Aspek Keruangan Tipe Longsoran di DAS Alo Provinsi Gorontalo [Distribution of Landslide Type Spatial Aspects in the Alo Watershed, Gorontalo Province]. Jurnal Manusia dan Lingkungan, Vol. 21(3): 277-285.
- [2] Japan International Coorperation Agency The Government of Indonesia. (2002)The Study on flood control and water management in Limboto-Bolango-Bone in the Republic of Indonesia. Gorontalo: Nikken Consultants Inc and Nippon Koei CO., LTD.
- [3] Eraku, S, S., and Permana, A.P. (2020) Erosion Hazard Analysis in The Limboto Lake Catchement Area, Gorontalo Province, Indonesia. News of the National Academy of Sciences of the Republic of Kazakhstan, Series of Geology and Technical Sciences. Vol. 3 (441): 110-116. https://doi.org/10.32014/2020.2518-170X.61.
- [4] Bachri, S., and Apandi, T. (1993)Peta Geologi Lembar Tilamuta [Geological Map of Tilamuta Sheet]. Bandung: Pusat Penelitian dan Pengembangan Geologi.
- [5] Permana, A.P., Pramumijoyo, S., Akmaluddin and Barianto, D.H. (2021) Planktonic foraminiferal biostratigraphy of the Limboto Limestone, Gorontalo Province, Indonesia. Kuwait Journal of Science. Vol. 48 (1): 116-126.https://doi.org/10.48129/kjs.v48i1.6916.
 - [6] Permana, A.P., Pramumijoyo, S., and Eraku, S. S. (2021) Microfacies and Depositional Environment

- of Tertiary Limestone, Gorontalo Province, Indonesia. News of the National Academy of Sciences of the Republic of Kazakhstan, Series of Geology and Technical Sciences, Vol. 2 (446). 15-21. https://doi.org/10.32014/2021.2518-170X.29.
- [7] Haspiah. (2015)Sebaran Aspek Sosial Ekonomi Masyarakat DAS Alo di ProvinsiGorontalo [Distribution of Socio-Economic Aspects of the Alo Watershed in Gorontalo Province]. Essay, Universitas Negeri Gorontalo.
- [8] Reynolds, J. M. (1997)An Introduction to Applied and Environmental Geophysics. Chichester UK: J. Wiley and Sons.
- [9] Park, S. G., and Kim, J. H. (2005) Geological Survey by electrical resistivity prospecting in landslide area. Geosyst Eng, VIII(2): 35-42.
- [10] Bievre, G., Jongmans, D., Winiarski, T., and Zumbo, V. (2012) Aplication of geophysical measurements for assessing the role of fissures in water infiltration within a clay lanslide (Trieves area, French Alps). Hydrol Process, 2128-2142.
- [11] Perrone, A., Lappena, V., and Piscitelli, S. (2014) Electical resistivity technique for landslide investigation: A review. Earth Science Review, 65-82.
 - [12] Lowrie, W.(2007) Fundamental of Geophysics, Second Edition, Cambridge.
- [13] Cervantes, B., Polacek, A., and Rysavka, J. (2012) Contribution of electrical resistivity tomography applied to the slope deformation survey in Lidecko. Geo Science Engineering, III(2): 7-15.
 - [14] Loke M. H.(2011) Tutorial: 2-D and 3-D Electrical Imaging Survey Manual.
- [15] Loke M. H, Acworth I and Dahlin T.(2003) A comparison of smooth and blocky inversion methods in 2-D electrical imaging surveys. Explora. Geophysics, 34:183–187.

Publication Ethics and Publication Malpractice in the journals of the National Academy of Sciences of the Republic of Kazakhstan

For information on Ethics in publishing and Ethical guidelines for journal publication see http://www.elsevier.com/publishingethics and http://www.elsevier.com/journal-authors/ethics.

Submission of an article to the National Academy of Sciences of the Republic of Kazakhstan implies that the described work has not been published previously (except in the form of an abstract or as part of a published lecture or academic thesis or as an electronic preprint, see http://www.elsevier.com/postingpolicy), that it is not under consideration for publication elsewhere, that its publication is approved by all authors and tacitly or explicitly by the responsible authorities where the work was carried out, and that, if accepted, it will not be published elsewhere in the same form, in English or in any other language, including electronically without the written consent of the copyright-holder. In particular, translations into English of papers already published in another language are not accepted.

No other forms of scientific misconduct are allowed, such as plagiarism, falsification, fraudulent data, incorrect interpretation of other works, incorrect citations, etc. The National Academy of Sciences of the Republic of Kazakhstan follows the Code of Conduct of the Committee on Publication Ethics (COPE), and follows the COPE Flowcharts for Resolving Cases of Suspected Misconduct (http://publicationethics.org/files/u2/New_Code.pdf). To verify originality, your article may be checked by the Cross Check originality detection service http://www.elsevier.com/editors/plagdetect.

The authors are obliged to participate in peer review process and be ready to provide corrections, clarifications, retractions and apologies when needed. All authors of a paper should have significantly contributed to the research.

The reviewers should provide objective judgments and should point out relevant published works which are not yet cited. Reviewed articles should be treated confidentially. The reviewers will be chosen in such a way that there is no conflict of interests with respect to the research, the authors and/or the research funders.

The editors have complete responsibility and authority to reject or accept a paper, and they will only accept a paper when reasonably certain. They will preserve anonymity of reviewers and promote publication of corrections, clarifications, retractions and apologies when needed. The acceptance of a paper automatically implies the copyright transfer to the National Academy of Sciences of the Republic of Kazakhstan.

The Editorial Board of the National Academy of Sciences of the Republic of Kazakhstan will monitor and safeguard publishing ethics.

(Правила оформления статьи для публикации в журнале смотреть на сайтах:

www:nauka-nanrk.kz

http://www.geolog-technical.kz/index.php/en/

ISSN 2518-170X (Online), ISSN 2224-5278 (Print)

Редакторы: М. С. Ахметова, Р. Ж. Мрзабаева, Д. С. Аленов Верстка на компьютере В.С. Зикирбаева

Подписано в печать 15.06.2021. Формат 60х881/8. Бумага офсетная. Печать – ризограф. 4,6 п.л. Тираж 211. Заказ 3.

Национальная академия наук РК 050010, Алматы, ул. Шевченко, 28, т. 272-13-18, 272-13-19

THE ANALYSIS OF SLIDING SURFACE IN ALO WATERSHED, GORONTALO DISTRICT, INDONESIA

	ALITY REPORT	DISTRICT, INDOI	NESIA	
7	% ARITY INDEX	6% INTERNET SOURCES	5% PUBLICATIONS	3% STUDENT PAPERS
PRIMAR	Y SOURCES			
1	Adyrbek A. Zh. St COATIN	otskaya, B.N. Ka ova, A.S. Tukiba uigenbayeva, L. GS FROM ALKAI JRFACTANTS", R ry, 2022	ayeva, R.S. Sp D. Aikozova. LINE ELECTRO	abekova, "ZINC DLYTES
2	lib.unne			1 %
3	"Adobe System	ada, Edi Setiawa Flash-Based Mu in Basic Analog , Journal of Phys 2019	ıltimedia Lear and Digital El	ning
4	journal.u	ugm.ac.id		1 %
5	knepubl Internet Source	ishing.com		1 %



1 %

R J Lahay, S Koem. "Google earth engine and landsat data for detecting inundation changes in Limboto lake", IOP Conference Series: Earth and Environmental Science, 2021

< \ \ %

Publication

8 ir.knust.edu.gh
Internet Source

<1%

9 link.springer.com

<1%

Exclude quotes On Exclude bibliography On

Exclude matches

Off